




General Service

The General Service is intended to Reset the Service reminder indicator (SRI).



Now we take S80 2002 as an example to illustrate the operation:

Note: The highlight item in the figure indicates corresponding action.




1. step 1: select S80

SELECT MENU			
S80 (-06)			
S80 (07-)			
S90			
V40			
V50			
V70 (-00)			
V70 (00-08)			
V70 (08-)			
PAGE UP		PAGE DOWN	
HOME	BACK	PRINT	HELP
Start			 10:55




2. step 2: select year

SELECT MENU			
VIN			
1999			
2000			
2001			
2002			
2003			
2004			
2005			
PAGE UP		PAGE DOWN	
HOME	BACK	PRINT	HELP
Start			 10:55


3. step 3: select General Service

SELECT MENU			
General Service			
ECM(Engine Control Module)			
DIESEL ENG(Fuel system/Combined system)			
TCM(Transmission Control Module)			
ABS/BCM(Anti-brake System Module)			
SRS(Supplemental Restraint System Module)			
CEM(Central electrical module)			
PAGE UP		PAGE DOWN	
HOME	BACK	PRINT	HELP
Start			 10:56


4. step 4: select SRI

SELECT MENU			
Resetting the Service reminder indicator(SRI)			
PAGE UP		PAGE DOWN	
HOME	BACK	PRINT	HELP
Start			 10:56

5. step 5: SRI information:

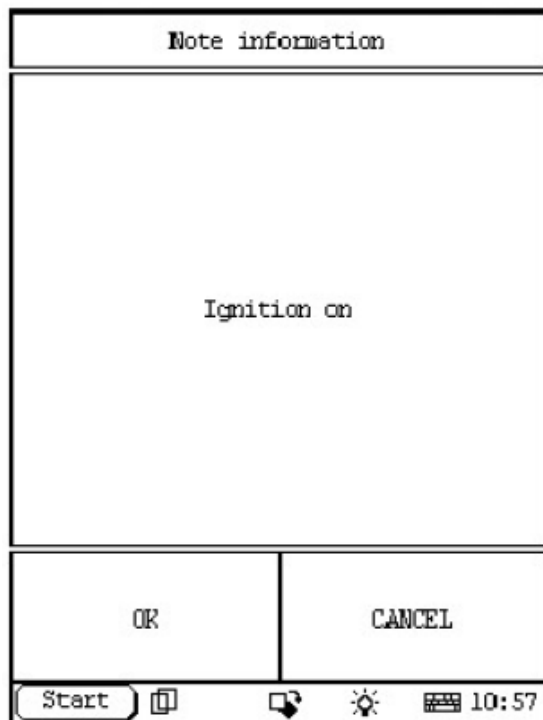

6. step 6: operation result:

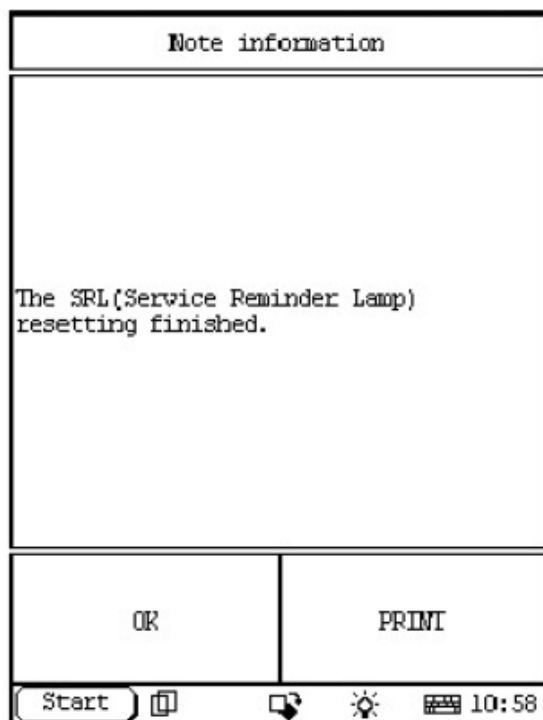

If the information displays "The SRL (Service Reminder Lamp) resetting failed", You can try to reset it in the DIM system.