




## Resetting the service reminder indicator (SRI)

This function is intended to reset the service reminder indicator.




Now we take C70 Conv 2002 09496757 A (ECU Diagnostic Part Number) as an example to illustrate the operation:

Note: The highlight item in the figure indicates corresponding action.




1. step 1: C70 Conv

SELECT MENU			
850			
960			
C70 Coupe			
<b>C70 Conv</b>			
S40 (-04)			
S40 (04-)			
S60			
S70			
PAGE UP		PAGE DOWN	
HOME	BACK	PRINT	HELP
Start			 14:20

2. step 2: select year

SELECT MENU			
1999			
2000			
2001			
<b>2002</b>			
2003			
2004			
2005			
PAGE UP		PAGE DOWN	
HOME	BACK	PRINT	HELP
Start			 14:21




3. step 3: select CI

SELECT MENU			
General Service			
ECM(Engine Control Module)			
TCM(Transmission Control Module)			
ABS/BCM(Anti-brake System Module)			
SRS(Supplemental Restraint System Module)			
CI(Combined Instrument)			
IMM(Immobilizer)			
PAGE UP		PAGE DOWN	
HOME	BACK	PRINT	HELP
Start			 14:21

4. step 4:


Either Service Reset or Special Function will displays on the screen depending on vehicle.  
If select Service Reset, it will go to step 6.

If you can't find the Special Function menu, it means the function has not been developed on your vehicle. Please record the VIN (Vehicle Identification Number) and Version Information (can be read by X431 with the function: Reading off control module ID) and email to Launch (x431@cnlaunch.com). We may work out a solution on how to solve the problem.

Select function			
Reading off control module ID			
Reading off Diagnostic Trouble Codes			
Erasing Diagnostic Trouble Codes			
Parameter display			
Activating components/functions			
Special Function			
PAGE UP		PAGE DOWN	
HOME	BACK	PRINT	HELP
Start			 14:21


5. step 5:

Select Resetting the service reminder indicator (SRI)

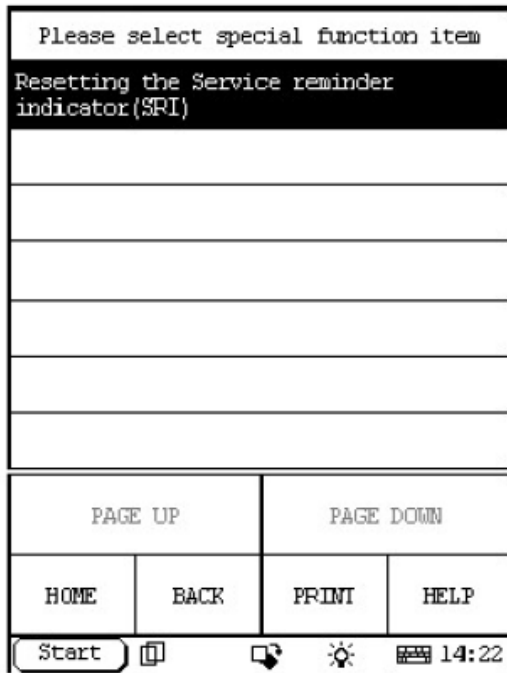

6. step 6:

The information of Resetting the service reminder indicator (SRI):  
Ignition on

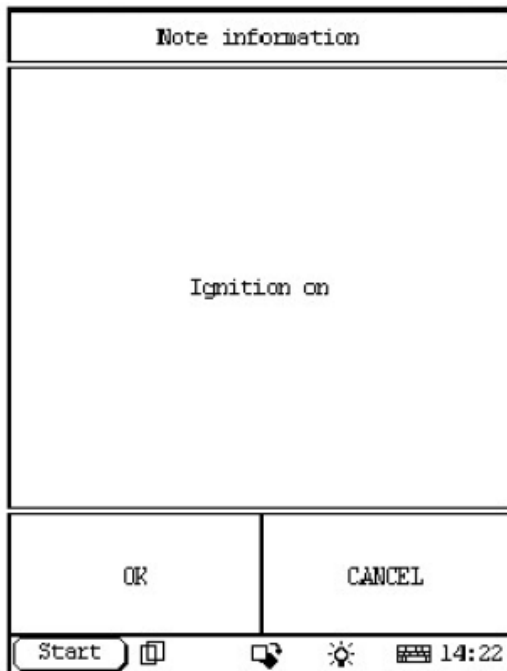





Please switch Ignition on as instruction, then click OK, it start to reset SRI.

7. step 7:

If Reset successes, it will display: The SRL (Service Reminder Lamp) resetting finished as the following figure.

If failed, it displays: The SRL (Service Reminder Lamp) resetting failed. In the case, please try again.

Note information	
The SRL(Service Reminder Lamp) resetting finished.	
OK	PRINT
Start     14:22	

LAUNCH