

Mercedes-Benz S400 Transmission Park Pawl Position Sensor Teach-in

Function Description: The DTC P280600 “Component Y3/8s4 (Park pawl position sensor) was not taught in” is detected in the transmission system of Mercedes-Benz S400. The park pawl position sensor teach-in function must be performed.

Supported Products: Launch PRO or PAD series comprehensive diagnostic equipment

Procedure:

1. The DTC P280600 “Component Y3/8s4 (Park pawl position sensor) was not taught in” is detected in the transmission system. (See the following figure.)

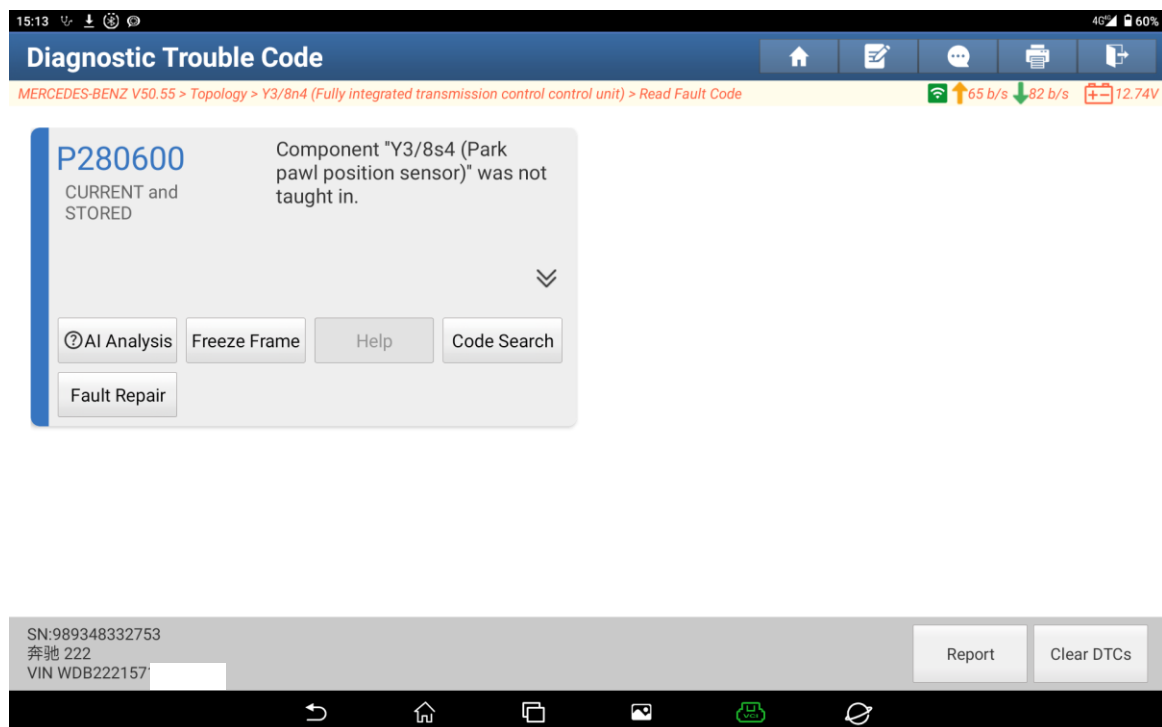


Figure 1

2. Choose [Special Function].

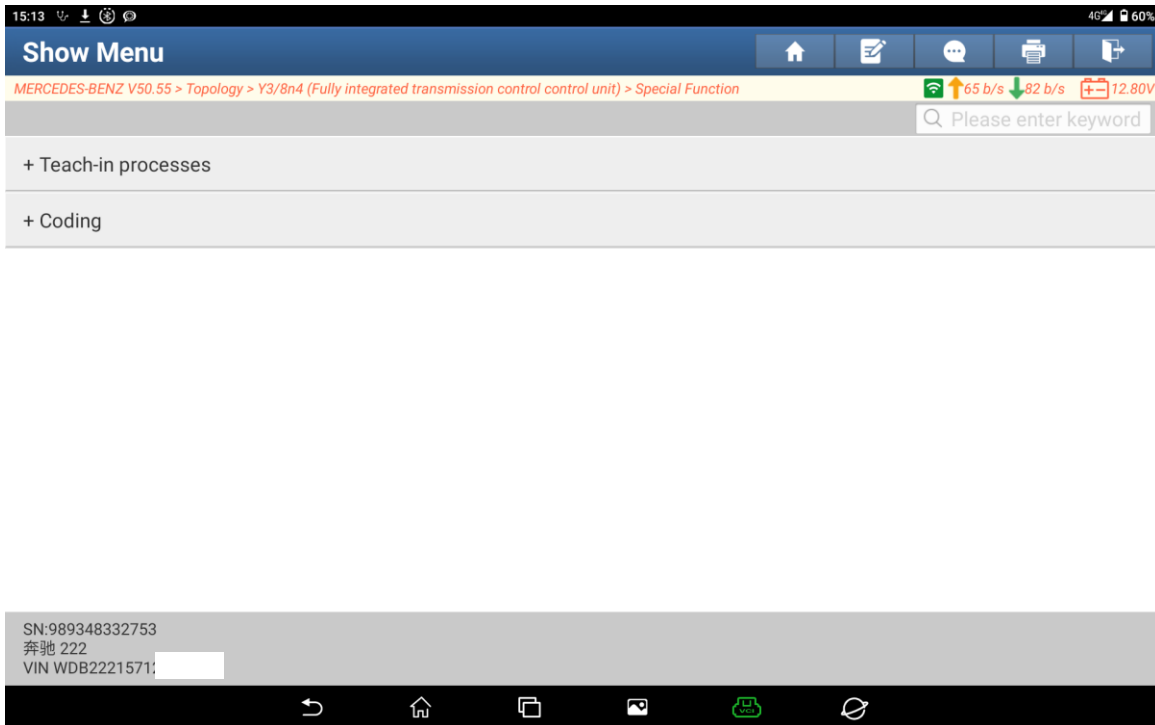


Figure 2

3. Choose [+ Teach-in processes].

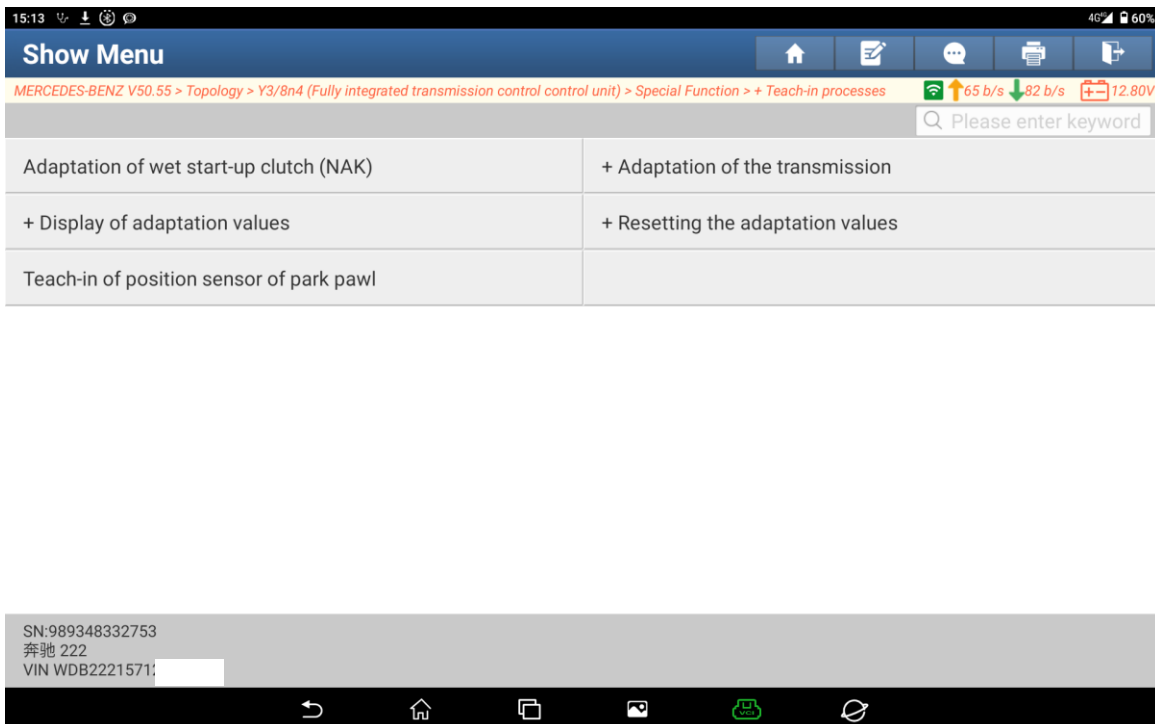


Figure 3

4. Choose [Teach-in of position sensor of park pawl].



Figure 4

5. Confirm that the conditions are met. Click [Continue].

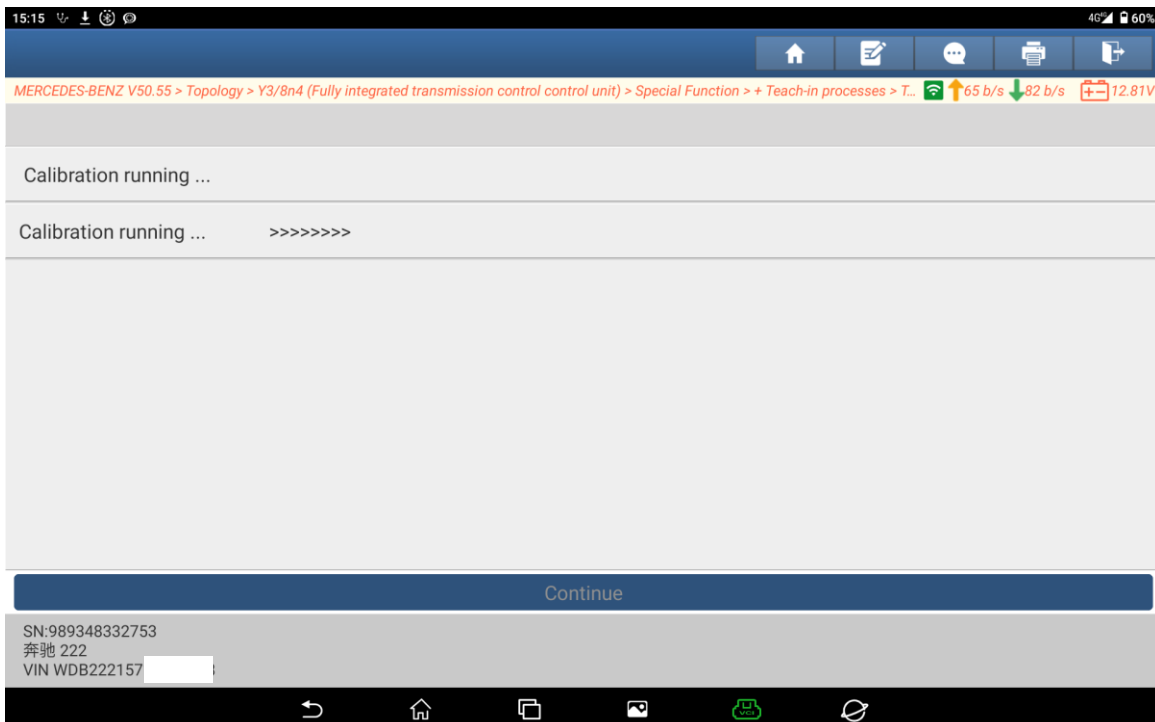


Figure 5

6. Control unit reset in progress. Please wait. (See the following figure.)

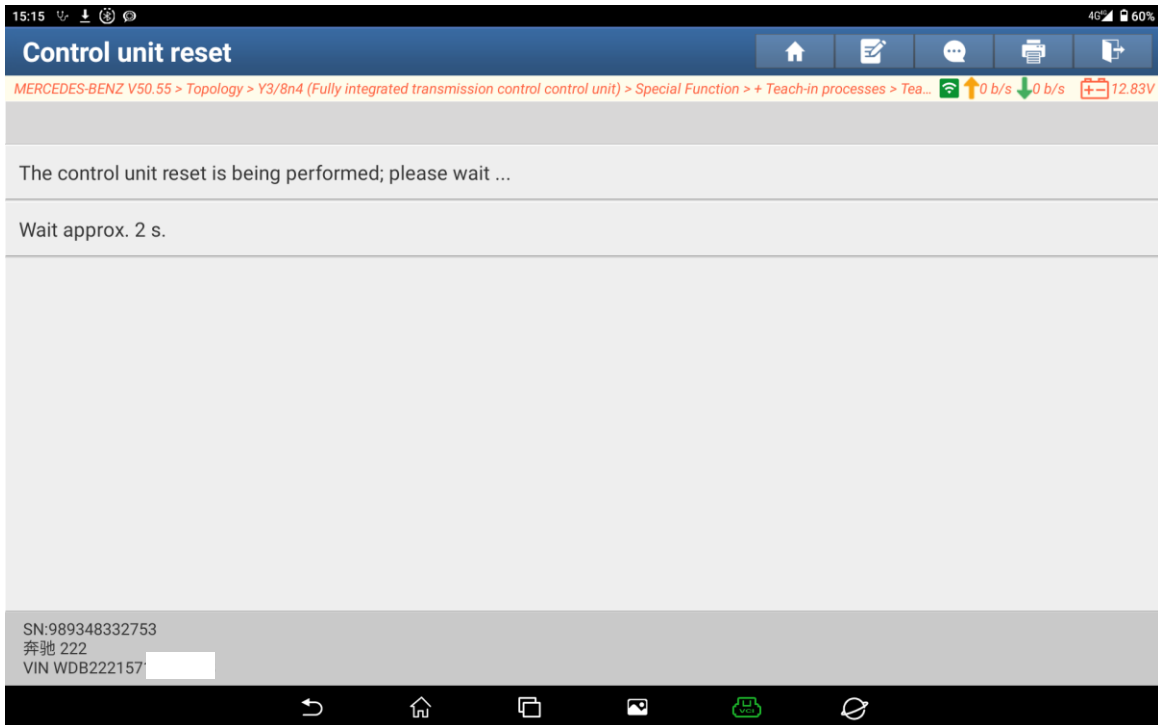


Figure 7

7. Turn off the ignition switch, and then click [OK]. (See the following figure.)

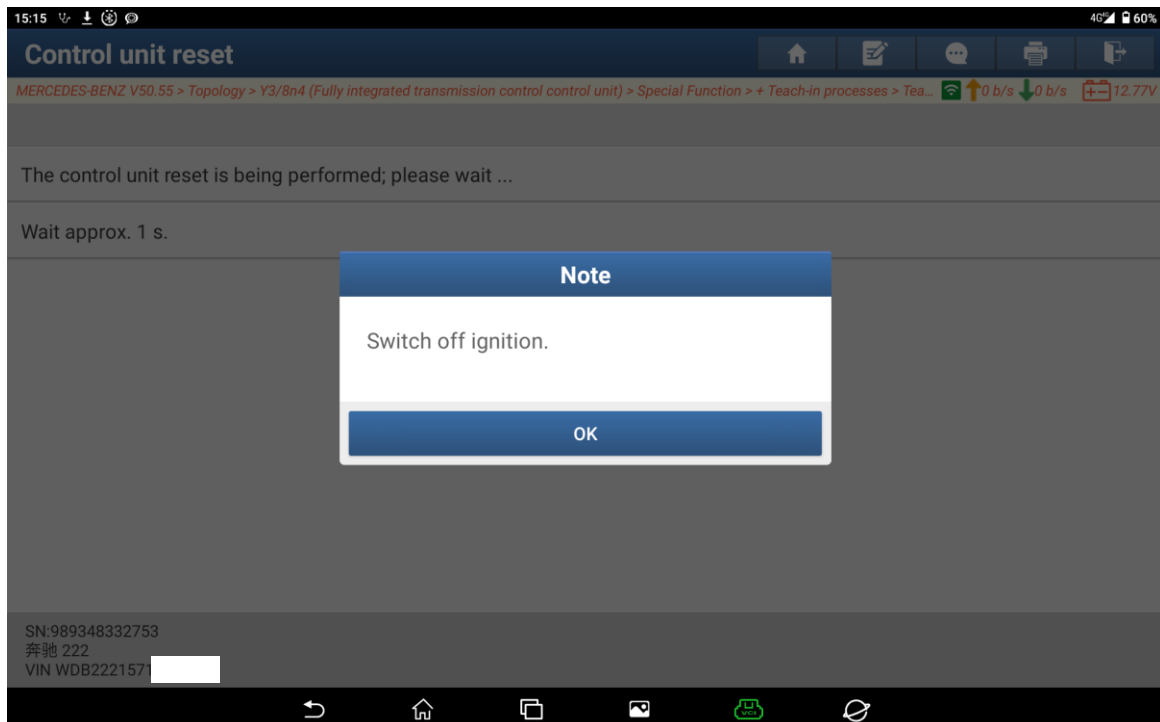


Figure 8

8. Turn on the ignition switch, and then click [OK]. (See the following figure.)



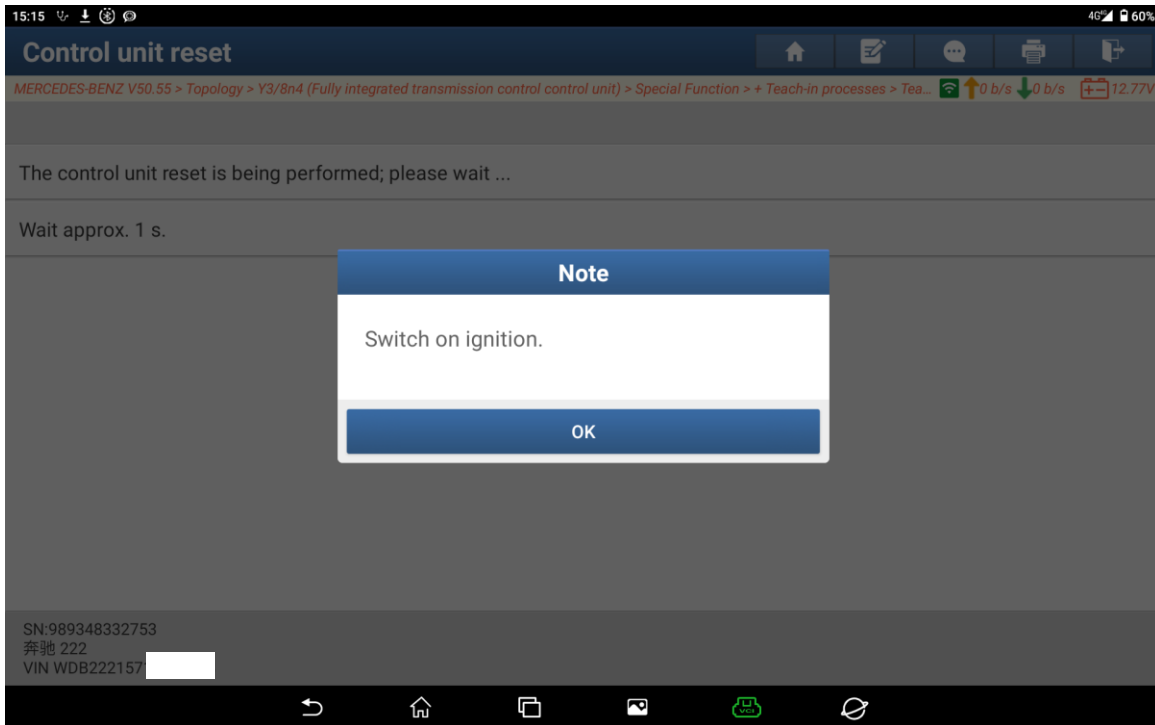


Figure 9

9. Procedure completed successfully. Click [Continue]. (See the following figure.)

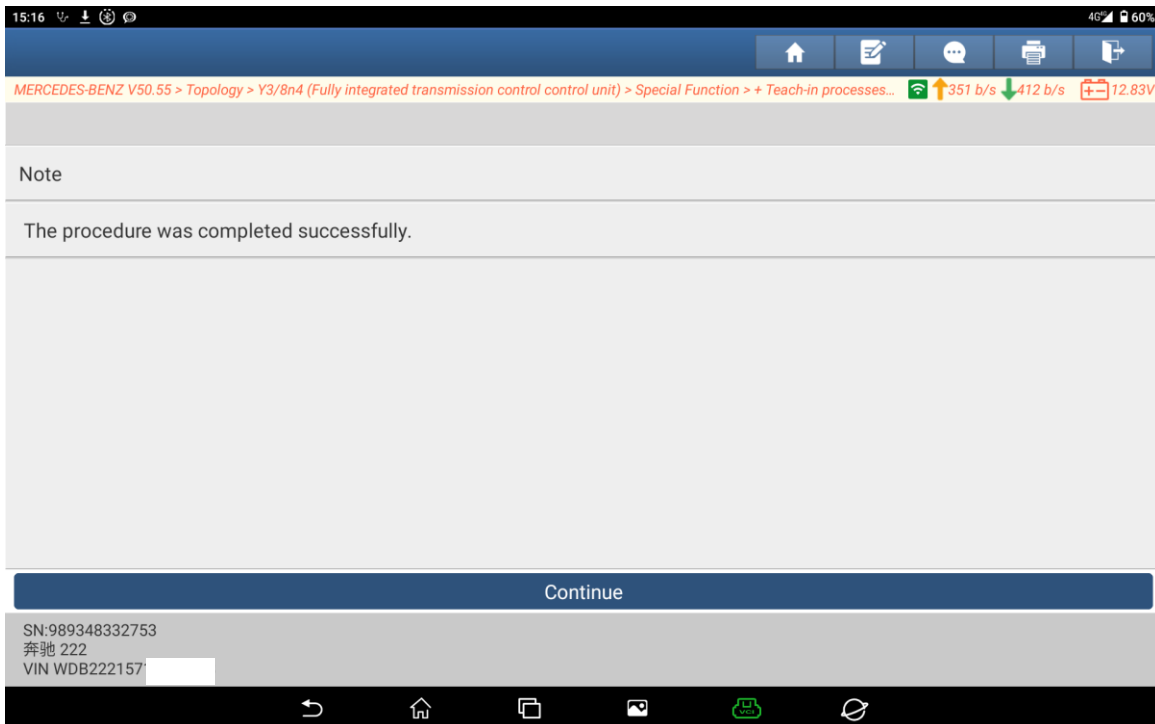

10. The DTC P280600 “Component Y3/8s4 (Park pawl position sensor) was not taught in” is cleared successfully. (See the following figure.)

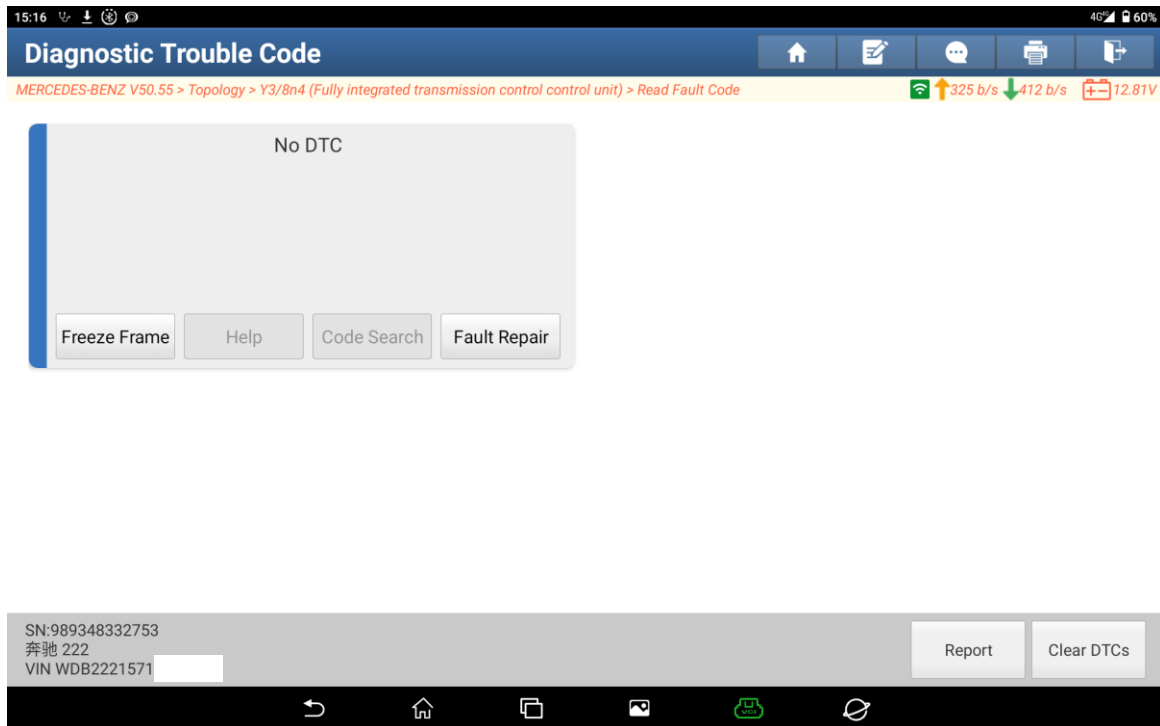

Statement:

The content of this document is copyrighted by LAUNCH TECH CO., LTD., and no individual or organization may quote or reprint it without consent.