

LAUNCH

VW Crash_Shut-Off_Activation_Reset_Steps

Volkswagen_TAYRON_2019

Model:

Volkswagen TAYRON 2019

Vehicle VIN:

LFV3B25N1K702****

Symptom:

Engine cannot start after the accident; the engine light is on, the data bus diagnostic interface system reports B189CF0 collision switch activation fault code

Solution:

Collision switch reset


Starting conditions:

The ignition switch is turned on, do not the start the engine, and the battery voltage is above 12V.


Steps:

1. "19 Gateway" system reports B189CF0 crash shut-off activation fault code.

LAUNCH

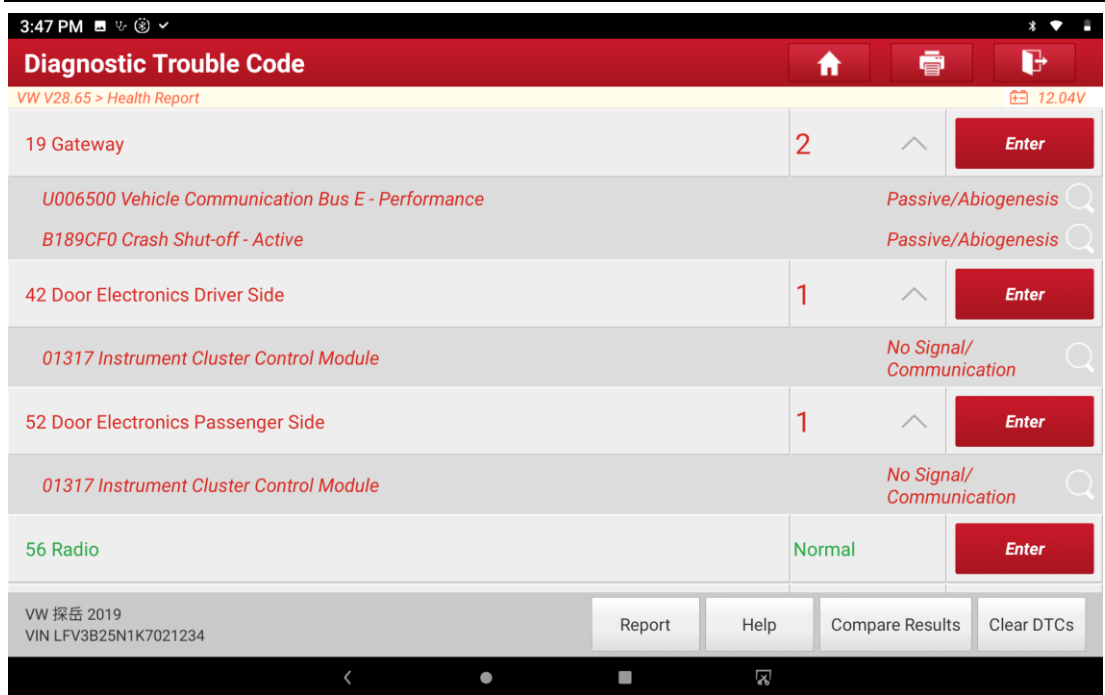


2. Enter "19 Gateway" system, select the option "Basic Settings".

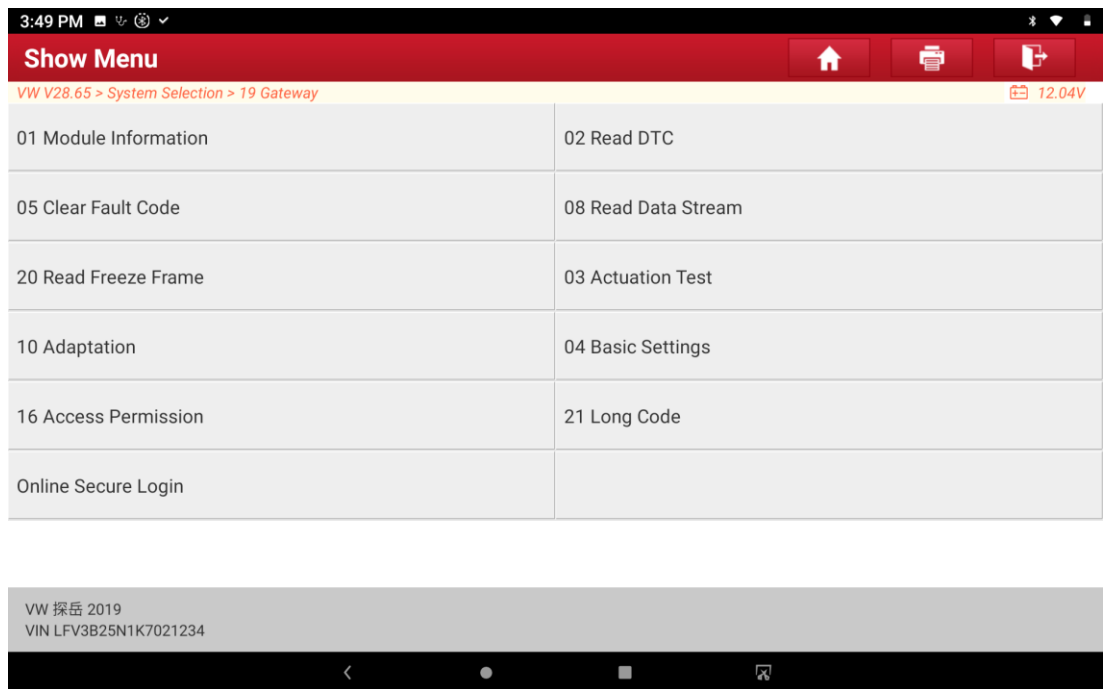


3. Select the option 'Reset Of Reversible Crash Shut-Off' checkbox and click OK to enter.

LAUNCH

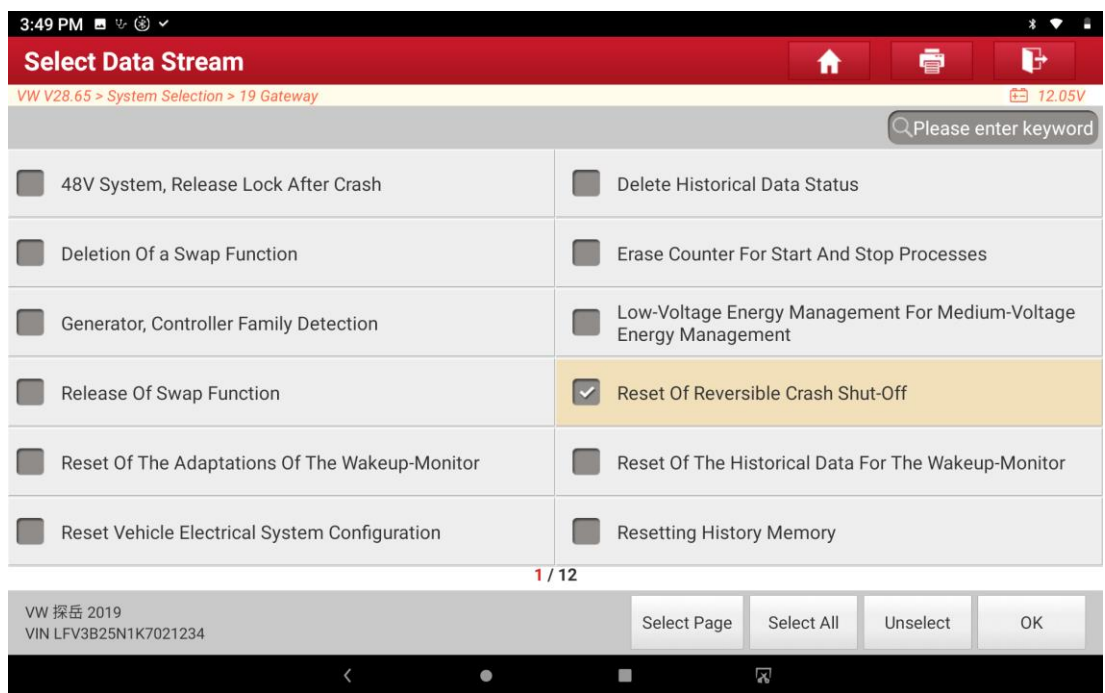

4. Click the lower left corner to adjust to reset.

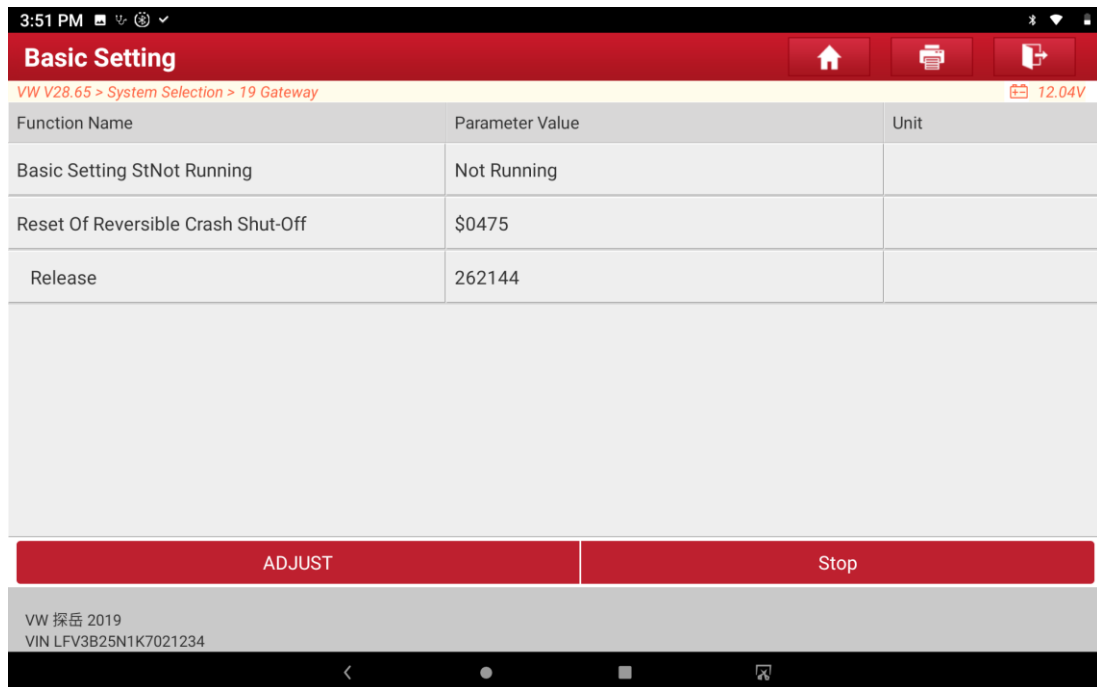

5. Until the basic setting status is displayed 'Finished correctly', just need clearing the fault code

LAUNCH

and start vehicle to check whether fixed.

3:53 PM

Basic Setting

VW V28.65 > System Selection > 19 Gateway 12.04V

Function Name	Parameter Value	Unit
Basic Setting StFinished Correctly	Finished Correctly	
Reset Of Reversible Crash Shut-Off	\$0475	
Release	262144	

ADJUST Stop

VW 探岳 2019
VIN LFV3B25N1K7021234

The end