

Instruction for the operation of Anti-Theft Key Matching - Add 1 Key for 2015 Honda Jade

Tested model

Honda JADE 2015, VIN: LVHFR1815F600****

Features

The process of key matching – Add 1 key.

Requirements

Product requirement: X-431 IMMO PRO, X-431 IMMO PAD

Software requirement: Honda Anti-theft software V10.01 and above

Notes

1. You must have an original key;
2. Before performing the operation, ensure that the vehicle battery voltage is not lower than 12V and the device has sufficient power;
3. During operation, strictly follow the device prompts to switch ignition ON/OFF within specified time;
4. After the key registration completed, check whether all the keys normally open and close the doors and start the engine normally.

Steps

1. Turn off the ignition switch (if the ignition switch has been turned on), prepare all the keys, and connect the diagnostic device, enter the corresponding IMMO module, and select HONDA Anti-theft diagnostic software, as shown in Figure 1.

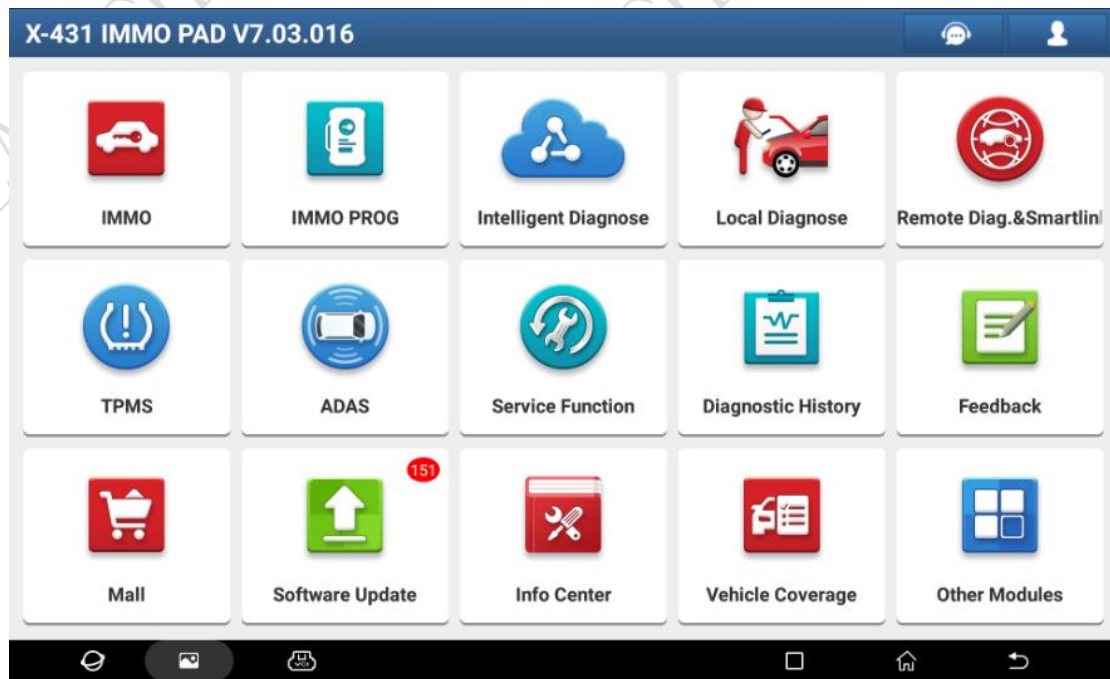


Figure 1

2. Select the menu **【Anti-Theft Key Matching】**, the software will automatically detect the Anti-theft type and display the corresponding function menu, as shown in Figure 2.

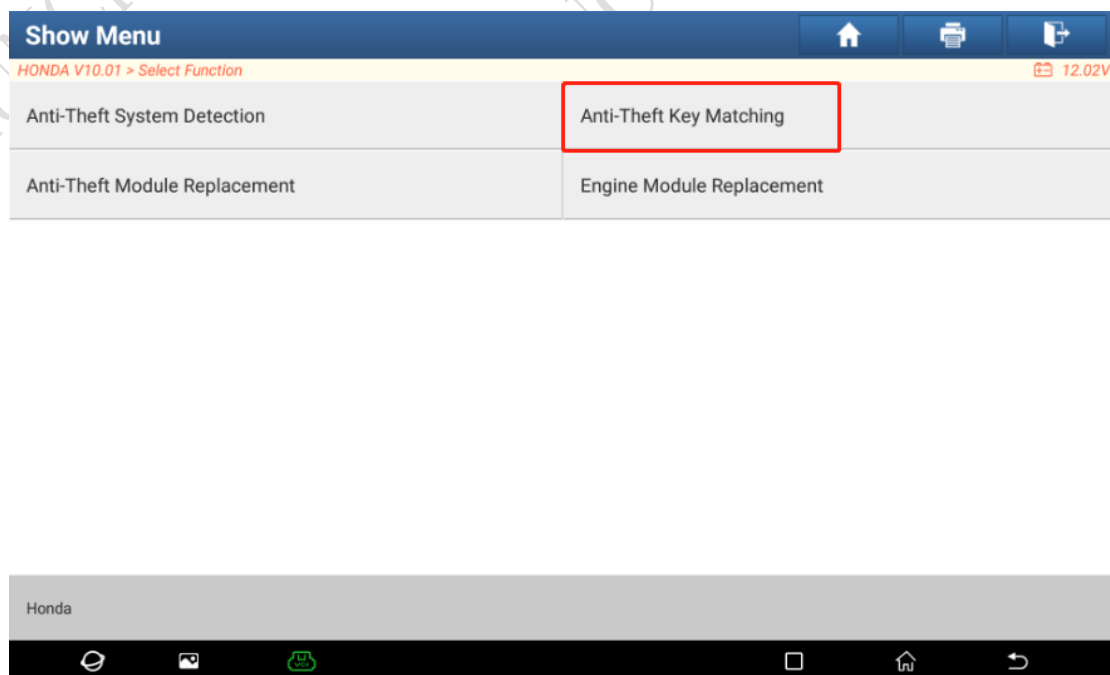


Figure 2

3. As described in above function introduction. Select the function **【Add 1 key】**, as shown in Figure 3.

Note: The steps for Rewrite Keys and All Keys Lost are similar to the steps of this function.

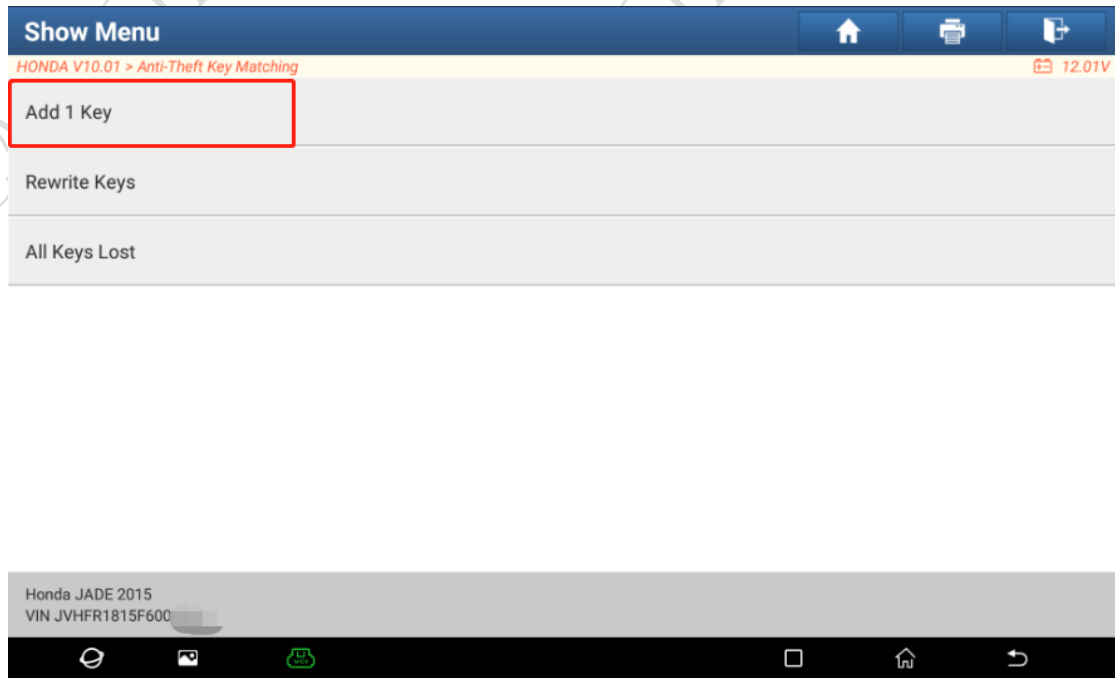


Figure 3

4. Perform interactive communication with Anti-theft system and follow the prompts to operate after normal communication. Turn the ignition switch off, as shown in Figure 4.

Note: This operation will be performed more than once during operating, please perform by strictly following the prompts.

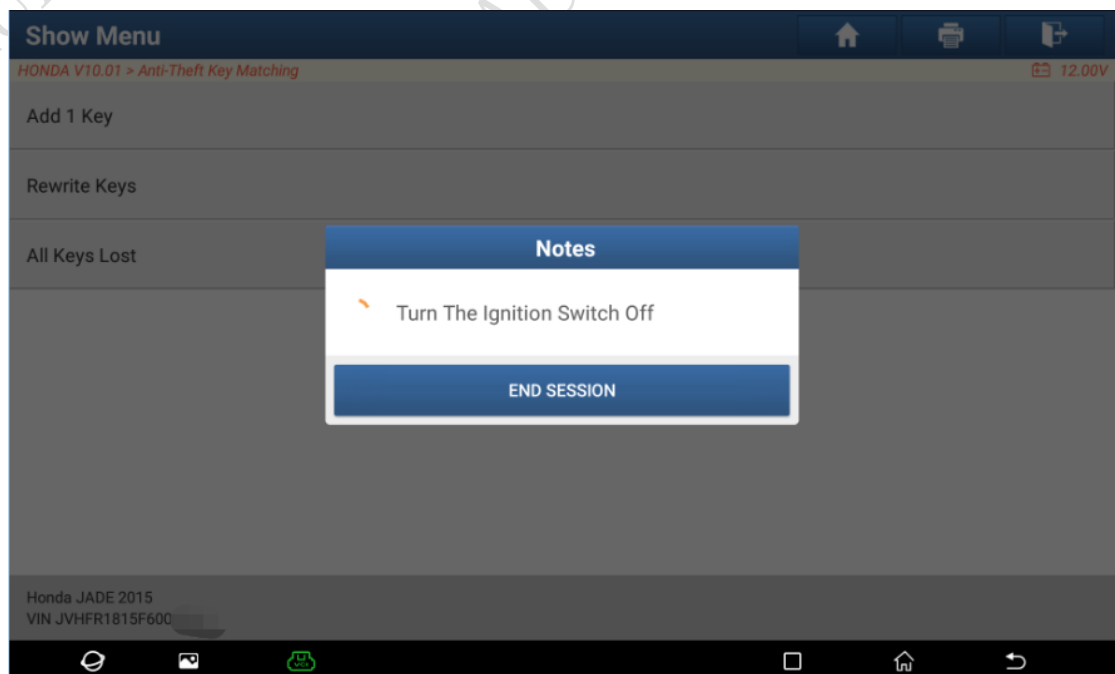


Figure 4

5. Turn the ignition switch to ON with an original key, as shown in Figure 5.

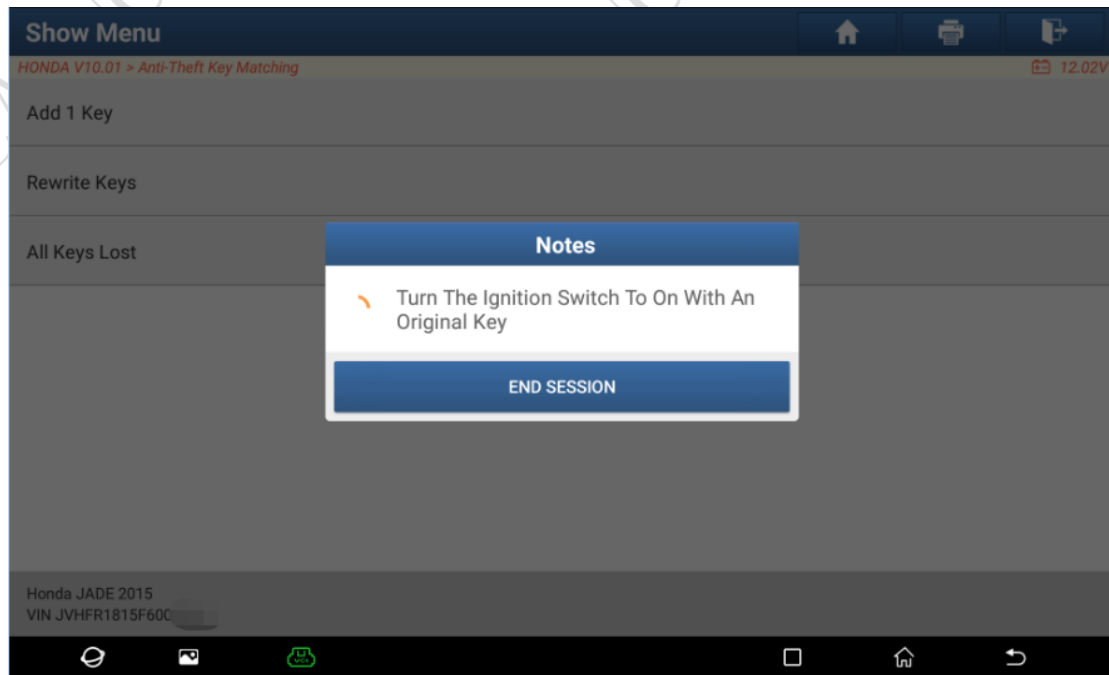


Figure 5

6. Turn the ignition switch off within 17 seconds, as shown in Figure 6.
- Note:** This operation will be performed more than once during operating, please perform by strictly following the prompts.

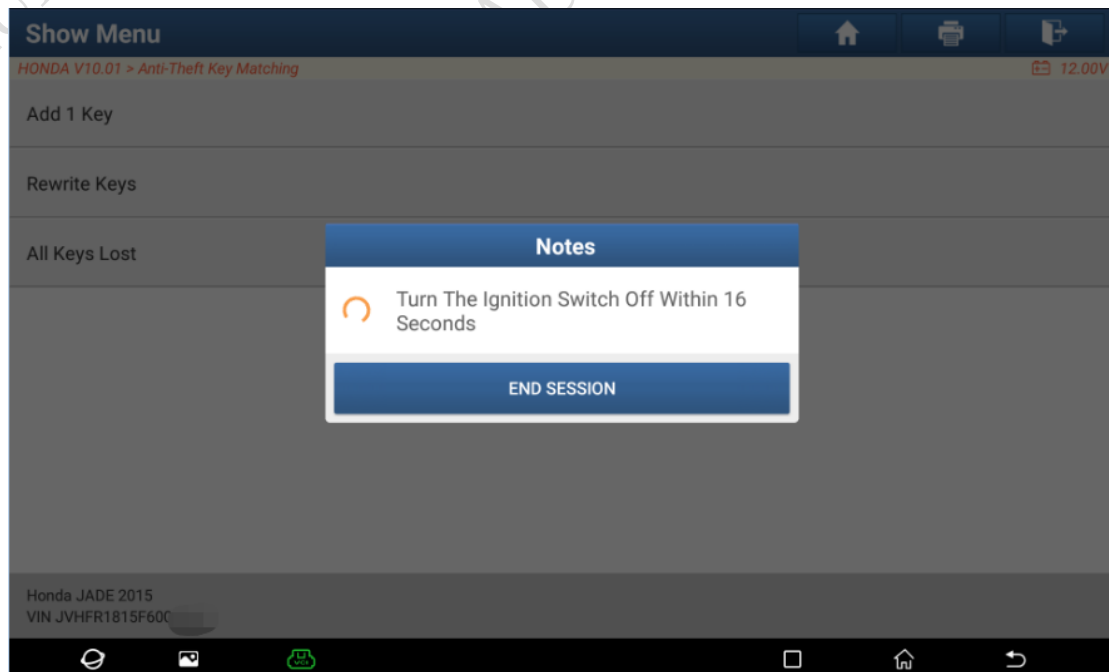


Figure 6

7. Turn the ignition switch to ON with a new key within 20 seconds, as shown in Figure 7.

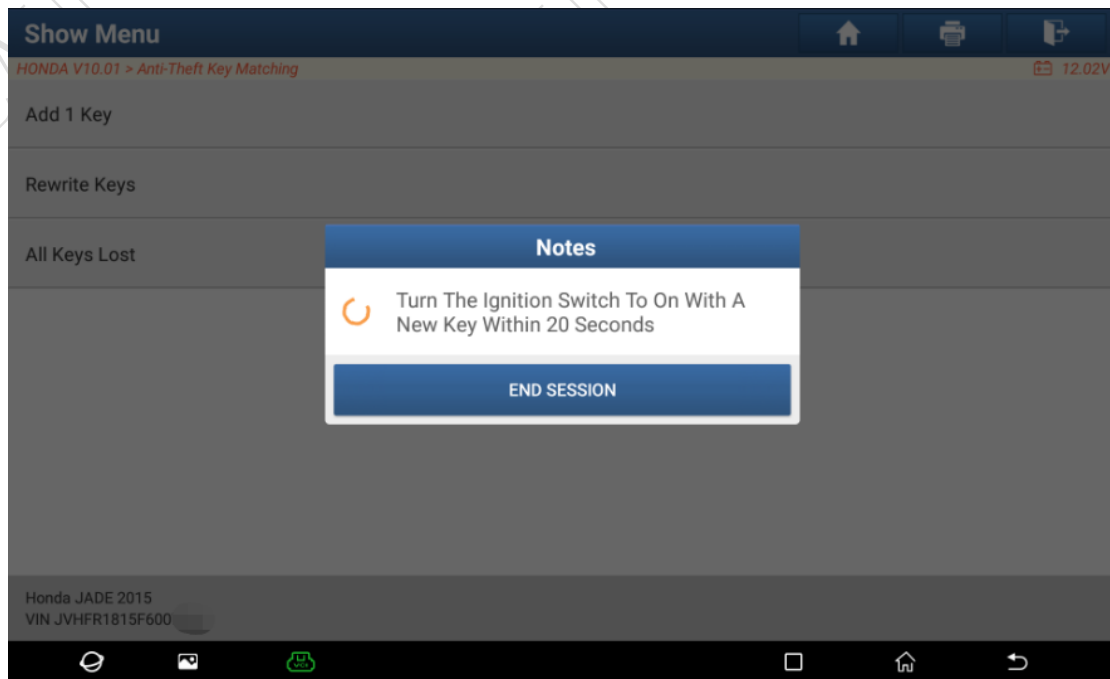


Figure 7

8. Turn the ignition switch off within 17 seconds, as shown in Figure 8.

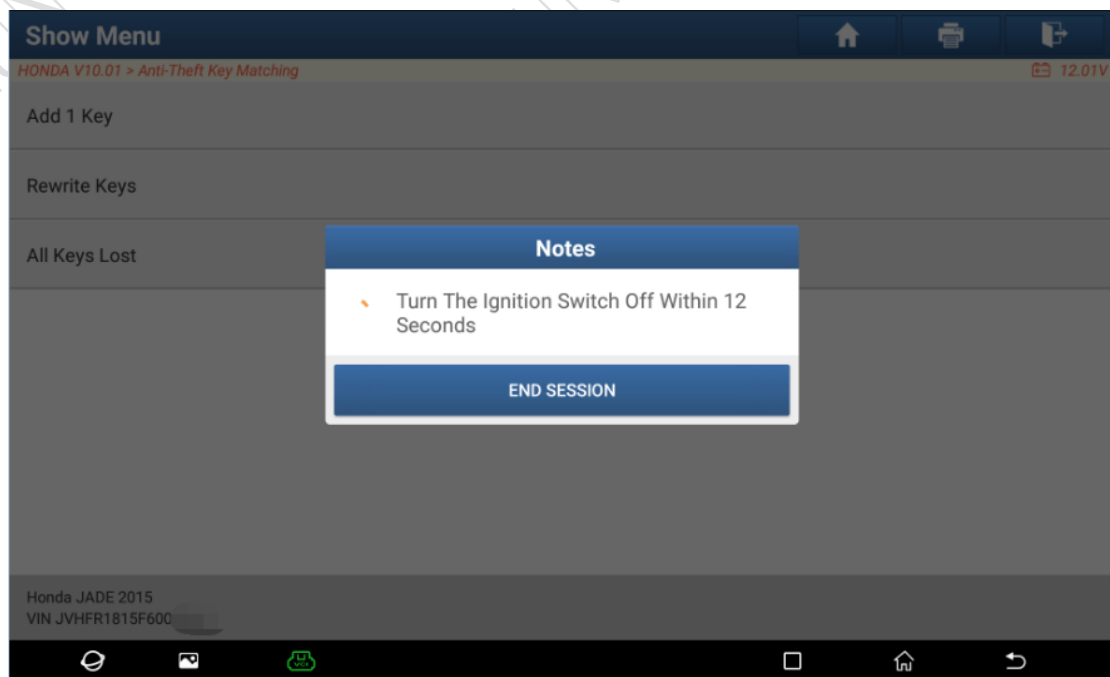


Figure 8

9. Turn the ignition switch to ON within 20 seconds without changing the key, as shown in Figure 9

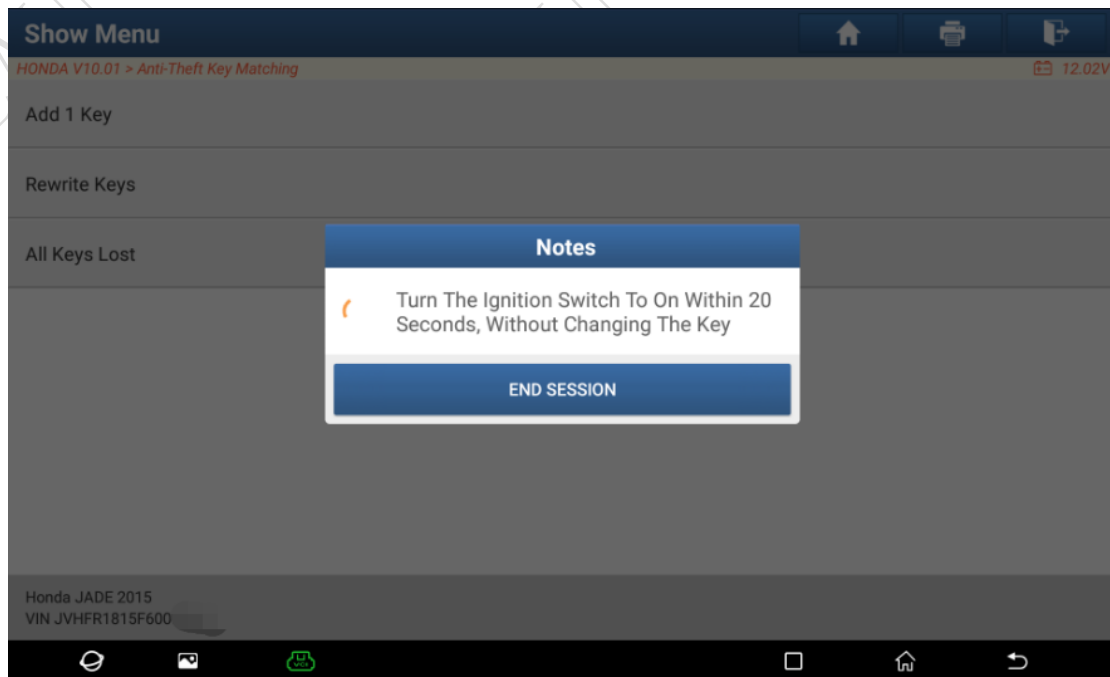


Figure 9

10. Turn the ignition switch off, as shown in Figure 10.

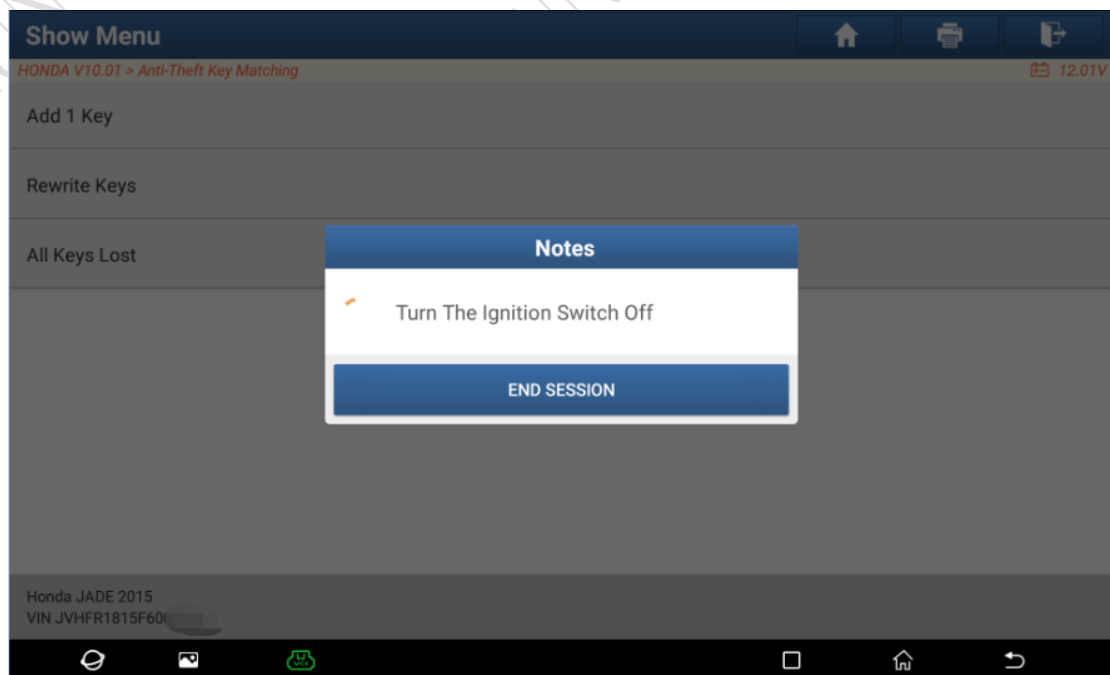


Figure 10

11. Turn the ignition switch on, as shown in Figure 11.

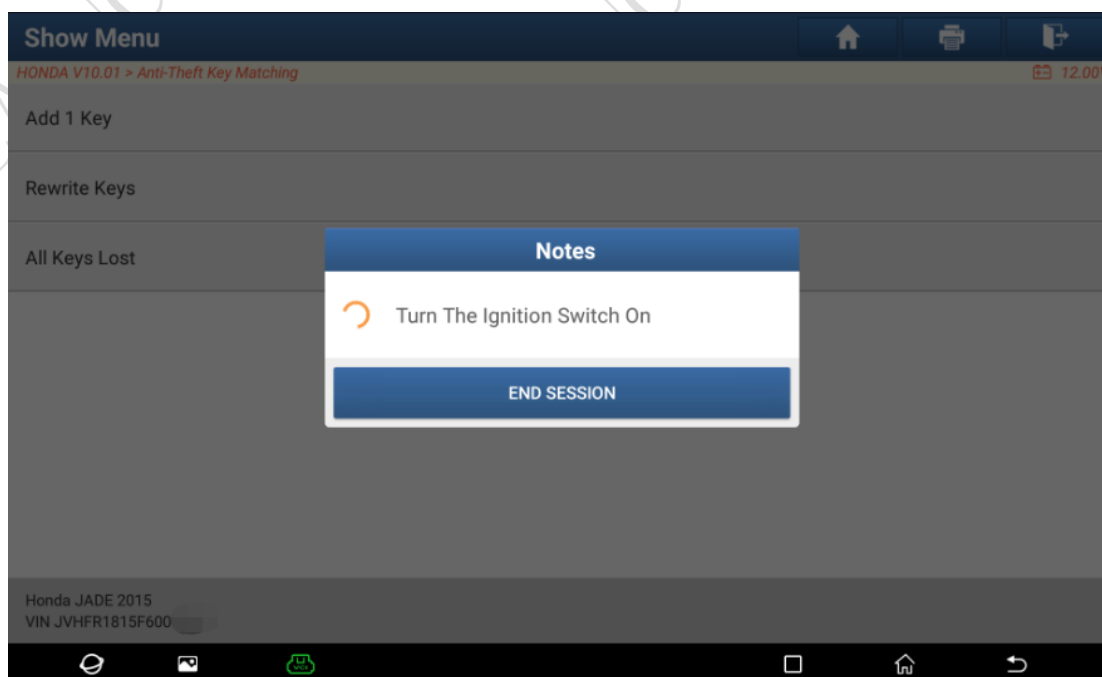


Figure 11

12. Check whether the immobilizer indicator light goes off. If it is not off, the matching failed; If it is off, continue to check whether the key matching is successful, as shown in Figure 12.

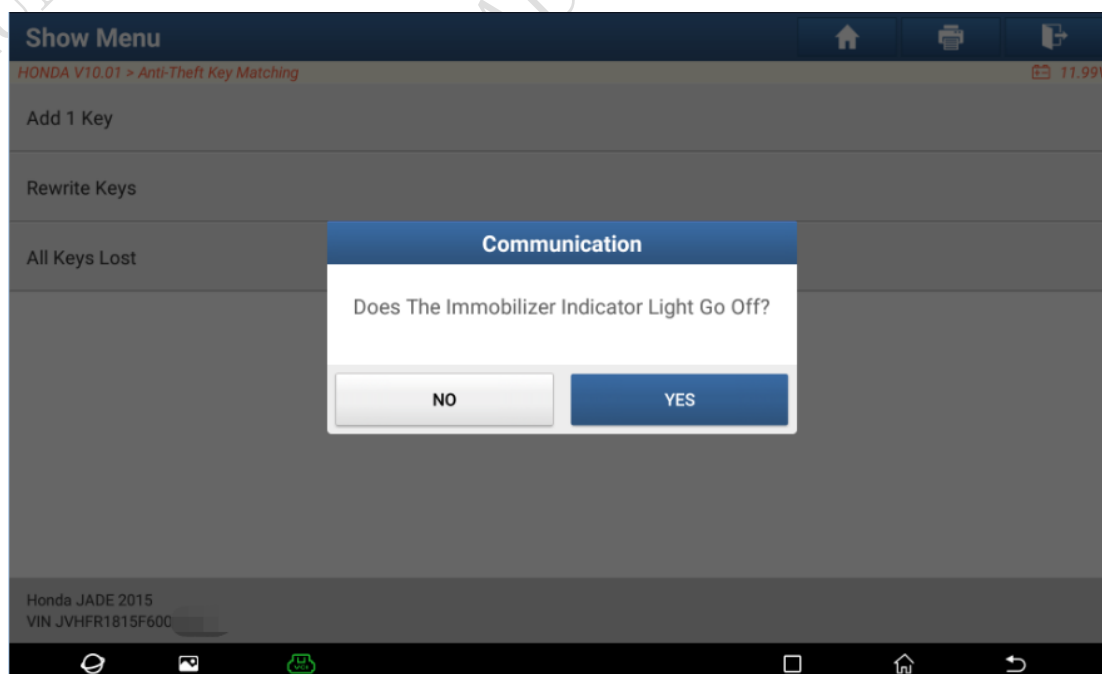


Figure 12

13. Click "Yes" and it will prompt again to turn the ignition switch off, as shown in Figure 13.

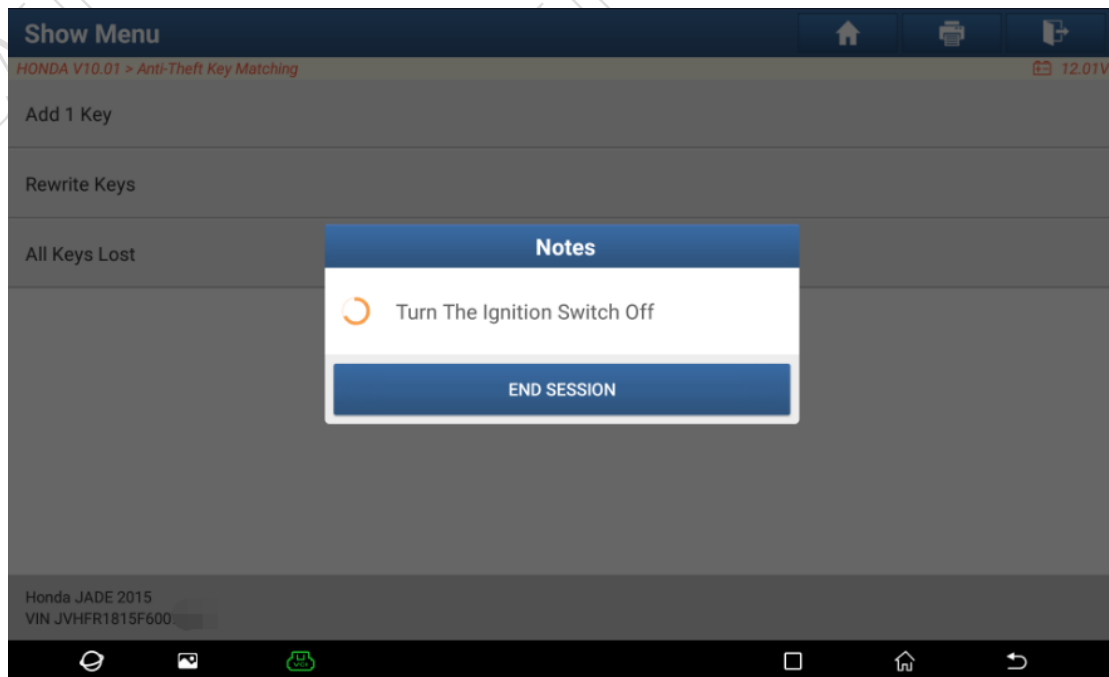


Figure 13

14. Turn the ignition switch to ON with an original key, as shown in Figure 14.

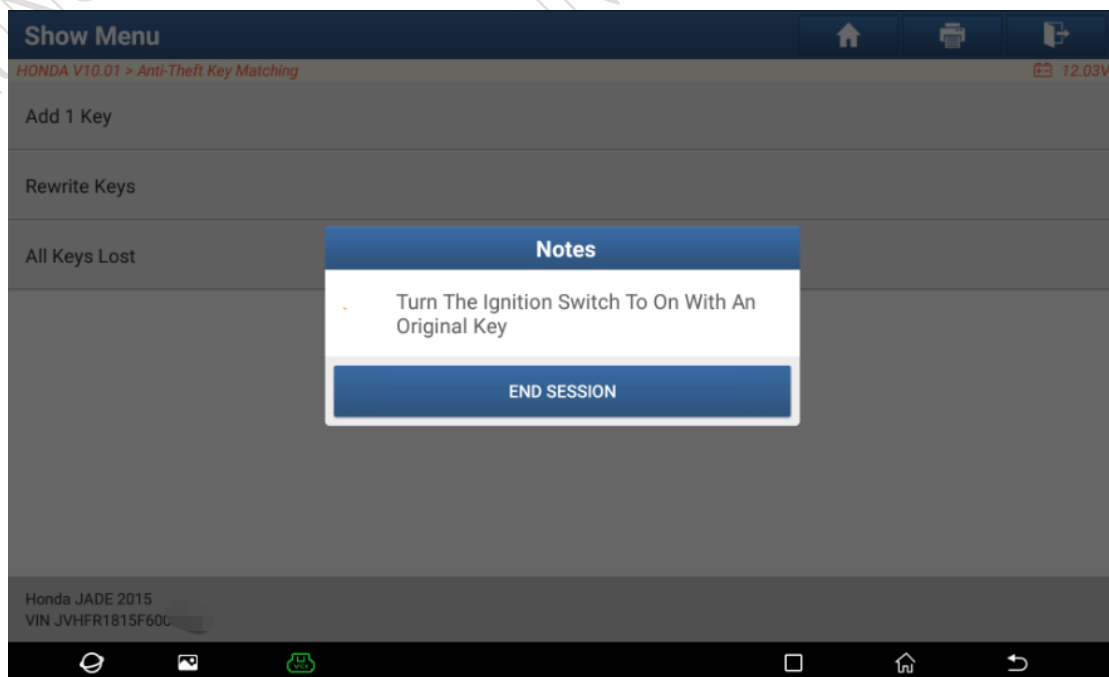


Figure 14

15. The registration of keys has been completed. Turn the ignition switch off, as shown in Figure 15.

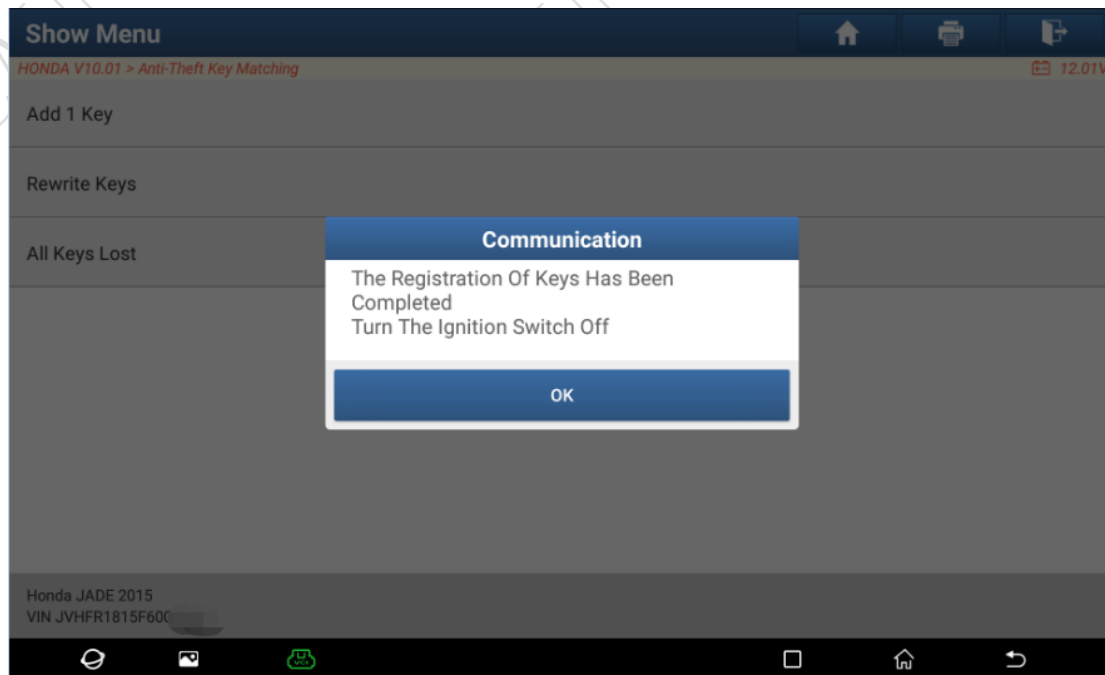


Figure 15

16. Check all keys to ensure that each key can start the engine, as shown in Figure 17.

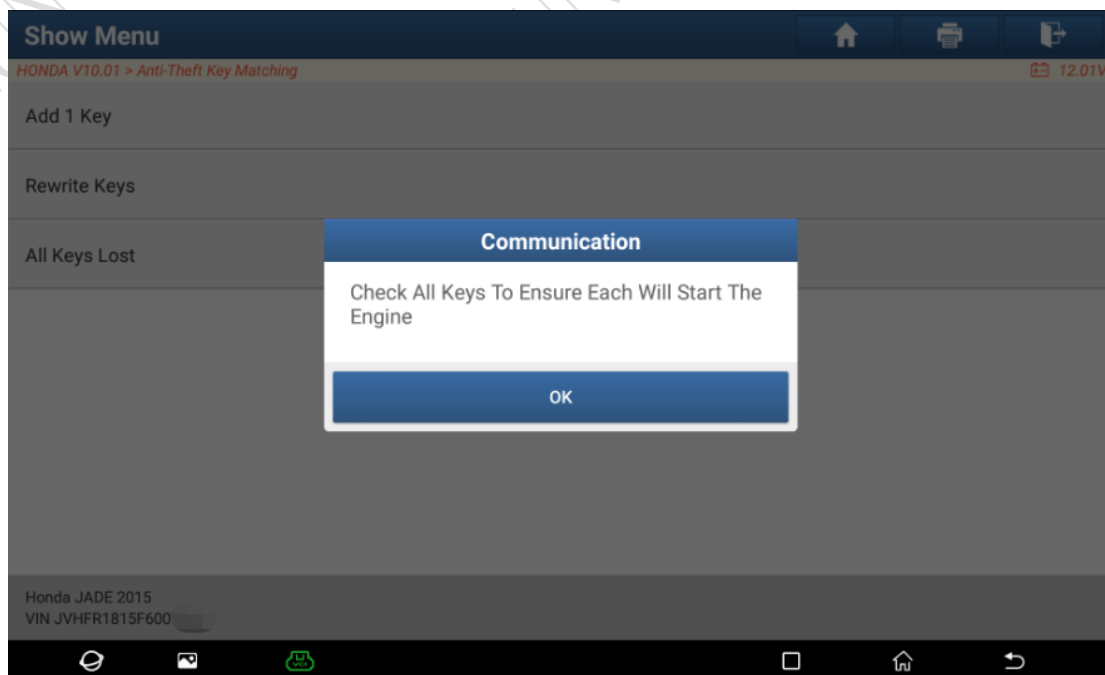


Figure 17

17. Turn the ignition switch ON. **Add 1 Key completed.**

Statement

The content of this document belongs to Shenzhen Launch. All rights reserved. Any individual or unit shall not quote or reprint without consent.