

# Porsche Panamera Rear Spoiler Adaptation

**Function Description:** When DTC B16F854 “Rear Spoiler, Drive 1 - Calibration” is present on Porsche Panamera, the rear spoiler adaptation function needs to be performed.

**Supported Products:** Launch PRO or PAD series comprehensive diagnostic equipment

**Tested Model:** 2017 Porsche Panamera, VIN: WP0AA297HL\*\*\*\*\* (see the following figure)



Instrument cluster prompt: Spoiler malfunction



## Procedure:

1. Confirm that the vehicle model information is correct, and click [OK]. (See the following figure.)

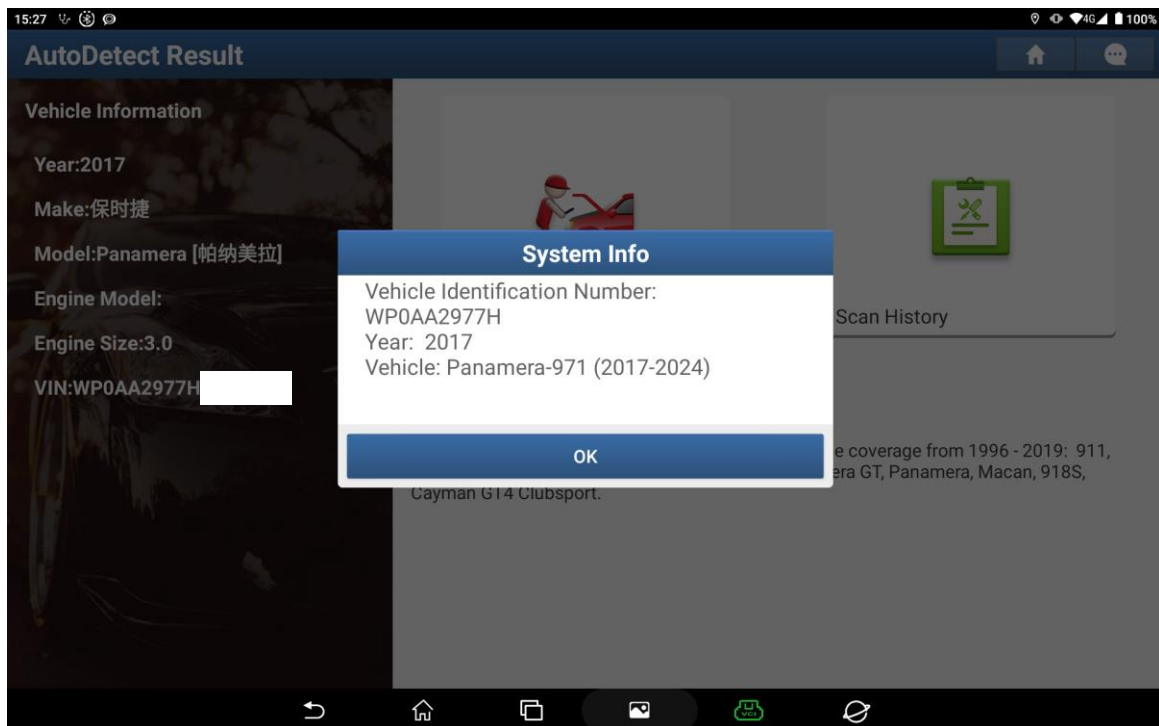


Figure 1

2. The DTC B16F854 “Rear Spoiler, Drive 1 - Calibration” is detected in the spoiler system. (See the following figure.)



Figure 2

3. Choose [Actuation Test]. (See the following figure.)

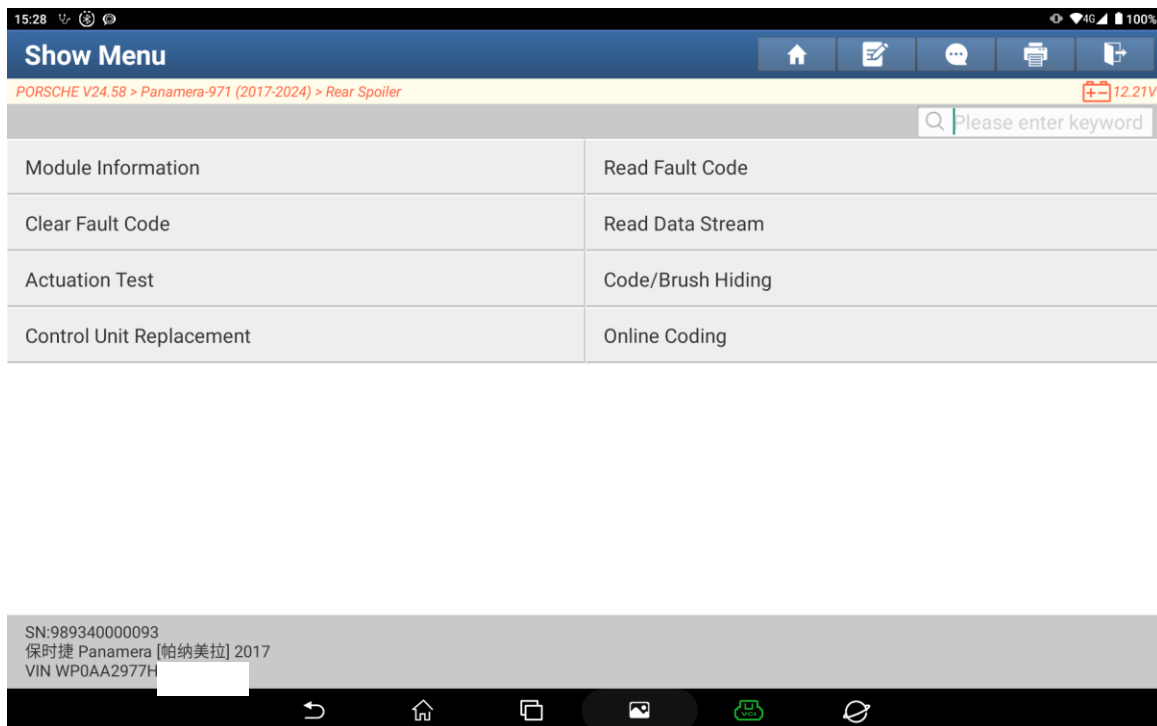


Figure 3

4. Choose [Rear Spoiler, adapting]. (See the following figure.)

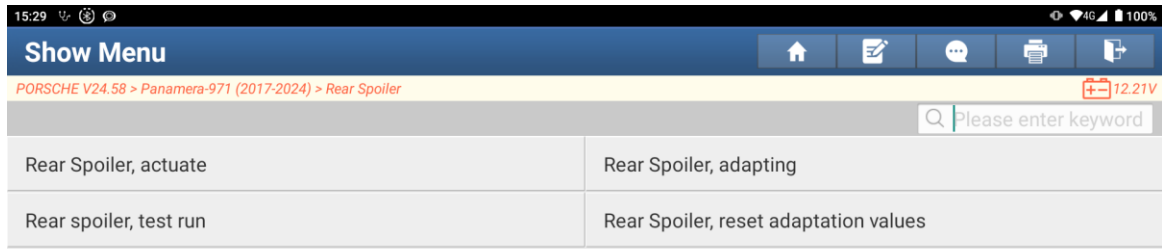


Figure 4

5. Click [Actuated]. (See the following figure.)



Figure 5

6. Adaptation active. (See the following figure.)



Figure 6

7. The rear spoiler opens. (See the following figure.)



Figure 7

8. The rear spoiler closes. (See the following figure.)



Figure 8

9. There is no DTC in the rear spoiler system. (See the following figure.)

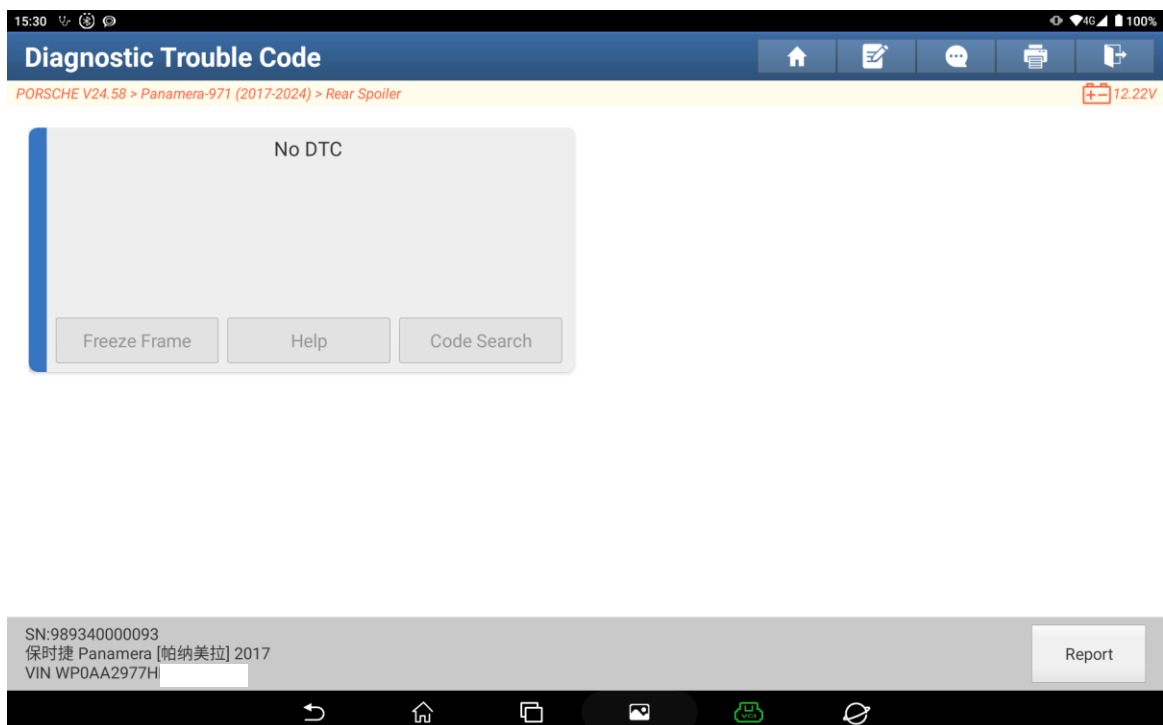


Figure 9

10.No malfunction message is displayed on the dashboard. (See the following figure.)



Figure 10

### Statement:

The content of this document is copyrighted by LAUNCH TECH CO., LTD., and no individual or organization may quote or reprint it without consent.